

# QDec Measurement Summary

## Measurement Information





<b>Panel:</b>	Helio_BJ61	<b>Meas. Date:</b>	11.05.2016 - 03:22:03
<b>Paneltype:</b>	Heliostat	<b>Operator:</b>	DLR Expert User
<b>Setup:</b>	MeasPosition	<b>Comment:</b>	
<b>Negl. Rim:</b>	0 mm	<b>System:</b>	QDec_2014-101
<b>Orientation:</b>	Mean Slope to Zero	<b>Location:</b>	Jülich

## Result Overview

**Quality:** no specifications      Evaluated Surface: 98.1 %

Value	Measurement	Specification	Description
SDx	0.67 mrad		Slope deviation in x-direction (rms)
SDy	0.82 mrad		Slope deviation in y-direction (rms)
ICAP_D1	95.99 %		Intercept on aperture

## Result Graphs

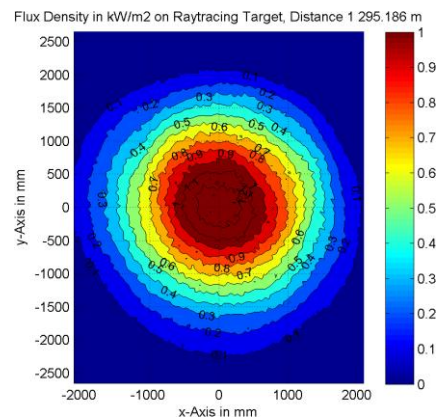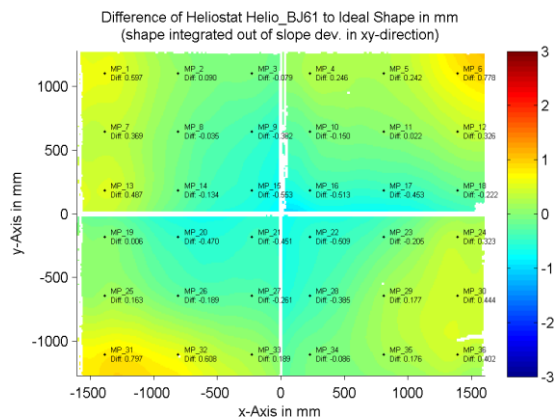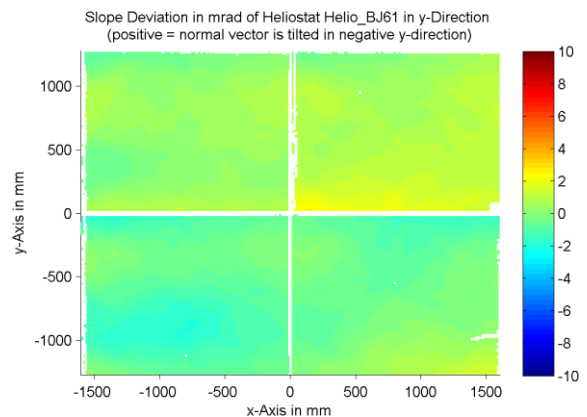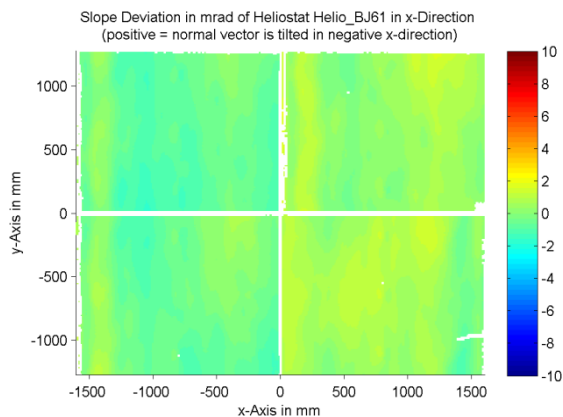

## Measurement System Information

Config File:	130929_Helio	QDec Version:	3.1.3680 (14.05.2014)
Evaluation Date:	12.05.2016 - 11:57:40		
Last Calibration:	14.08.2014		
PDF Filename:	...\MeasData_160510\Results\Helio\Helio_BJ61\Helio_BJ61_Rim0_Result_160512115740.pdf		